

ATL02 Known Issues & Advisories List

Applicable Version: Release 002

Last Updated: August 30, 2019

ADVISORIES

- The algorithm window used for transmitter echo identification is 100ns wide. The DLB width of an exclusively TE-seeking band is ~170ns wide. Thus, when plotting the ground return photon cloud and filtering out the suspected TE returns, it may give the appearance of a thin, flat cloud with its middle 100ns portion missing. See ATL02 ATBD section 4.5.
- The `tof_flag` values incorporate information about the start centroid calculation as well as identifies if the return is a suspected TEP. See ATL02 ATBD sections 3.4.5 and 4.5 respectively.
- When plotting the return TOFs as a photon cloud, it is possible to see returns occurring outside the boundaries of the DLB. This is an expected behavior. See ATL02 ATBD section 3.8.5.
- The laser gives valid preamp voltage and current telemetry at energy level 0 and 6 or above. At levels 1 through 5, it gives 0 or previously valid stale values. See ATL02 ATBD section 8.4.

KNOWN OPEN ISSUES

IssueID	004 – Improper Misalignment Calculation
Release # When First Identified	001
Description	In the ATL02 ATBD as well as in the ASAS production code, the misalignment between the transmitter and the receiver is calculated incorrectly in Equation 5-13. The misalignment is used to estimate the receiver's sensitivity to return energy. The offset value from ANC27 is used as the misalignment, rather than the change in offset value. This can result in an overestimate of the optical throughput loss due to misalignment, and an underestimate of the return sensitivity.
Impact(s)	Documentation: ATL02 ATBD Product: ATL02 Calibration: N/A
Notes	To be corrected for Release 003
Status	Open

ISSUES RESOLVED IN RELEASE 002

IssueID	001 - Calibration product(s) using incorrect toggle information
Release # When First Identified	001
Description	The version of CAL-49 used in release 001 has reversed the rising + falling skew corrections. The impact of this issue is that TEP histograms will be broadened by ~50ps.
Impact(s)	Documentation: ATL01 ATBD, ATL02 ATBD, ATL03 ATBD Product: ATL02, ATL03 Calibration: 17, 49
Notes	Corrected in Release 002
Status	Resolved

IssueID	002 – Documentation Missing for Groups
Release # When First Identified	001
Description	The following groups are not documented in the ATBD: <ul style="list-style-type: none">• <code>/atlas/housekeeping/time_at_the_tone</code>• <code>/atlas/pcex/background</code>

	Contents of group has been verified and are as expected.
Impact(s)	Documentation: ATL02 ATBD Product: N/A Calibration: N/A
Notes	Corrected in Release 002
Status	Resolved

IssueID	003 – Improper Temperature Reference for CAL-54 Selection
Release # When First Identified	001
Description	In the ATL02 ATBD as well as in the ASAS production code, the laser optics radiator temperature is called out for use with CAL-54 when computing transmitted energy from LRS laser spot magnitudes. According to the CAL-54 CPD, CAL-54 was derived using “APID 1120, A_LRS_HK, ANALOGHK channel 33, LRS Laser Detector Card Thermistor”. This appears in ATL01 as <i>/lrs/hk 1120/raw ldc t.</i>
Impact(s)	Documentation: ATL02 ATBD Product: ATL02 Calibration: N/A
Notes	The code and the documentation updated to match CAL-54 for Release 002.
Status	Resolved